



BAS Dealer Service Note 10/29/96

Automatic Daylight Savings Time Update

Description of Problem

On BAS Sites using the Windows 95 operating system, the Fall transition from Daylight Savings Time to Standard Time can be performed twice. The clock will then be one hour behind actual Standard Time.

Extent of Problem

This only affects BAS Sites using Windows 95.

Cause of Problem

If both Windows 95 and the BAS system are configured for automatic Daylight Savings Time update, both will perform the update.

Solution

Eliminate one of the two automatic updates. It is recommended that the BAS update be disabled and the operating system be allowed to perform this task. The updates are disabled in the following manner:

1. To eliminate the BAS update, select Site Configure/General Settings and un-check 'Automatic Daylight savings Update'.
2. To eliminate the Windows 95 update, double-click on the clock on the lower right corner of the taskbar. Then select the Time Zone tab and un-check 'Automatically adjust clock for daylight savings changes'.